

CERTIFICADO DE CALIDAD


 NOMBRE DEL CLIENTE:
 PLESA ANAHUAC Y CIAS., S.A. DE C.V.

 N° CONF. PEDIDO:
 156408

 PRODUCTO:
 G42I0H0 V. CORRUGADA G42 (#12) 38.1mm A 12.0m

 FECHA DE EMBARQUE:
 28.12.2016

ANALISIS QUIMICOS						PRUEBAS FISICAS				
NUMERO DE COLADA	%C	%Mn	%Si	%P	%S	RESISTENCIA TENSION kg/mm2	LIMITE ELASTICO kg/mm2	ALARGAMIENTO %	REDUCCION AREA %	DOBLEZ 180°
M020039	0.40	1.22	0.190	0.011	0.013	72.92	48.34	13.50		CUMPLE
M026832	0.45	1.19	0.139	0.009	0.011	73.99	45.17	10.50		CUMPLE
M026840	0.44	1.24	0.179	0.012	0.010	76.45	48.94	12.50		CUMPLE
S388010	0.45	1.21	0.126	0.015	0.015	71.59	46.40	9.00		CUMPLE
S388014	0.43	1.18	0.136	0.010	0.011	72.57	47.32	11.25		CUMPLE
S389785	0.44	1.21	0.161	0.015	0.021	74.72	48.71	10.50		CUMPLE
S391789	0.45	1.21	0.149	0.009	0.007	74.85	47.37	14.00		CUMPLE
S391850	0.44	1.24	0.181	0.009	0.009	74.75	48.82	15.50		CUMPLE
PROMEDIO						73.98	47.63	12.09		

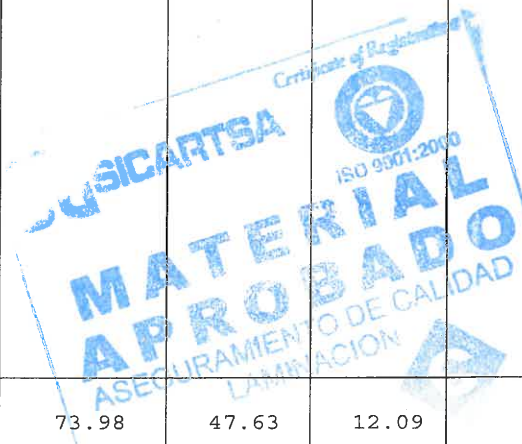

OBSERVACIONES:

 CERTIFICAMOS POR MEDIO DEL PRESENTE QUE EL PRODUCTO CUMPLE SATISFACTORIAMENTE LOS REQUISITOS DE LA NORMA:
 NMX-C-407 2001/ NMX-B506-2011
 ENTREGA: 80684099



HORA: 17:06:28

CALIDAD

LEO DAN CUEVAS XOLOT